


## 750071EJ

# VW Tiguan VW Tiguan Allspace

05/16 >> 08/17 >>



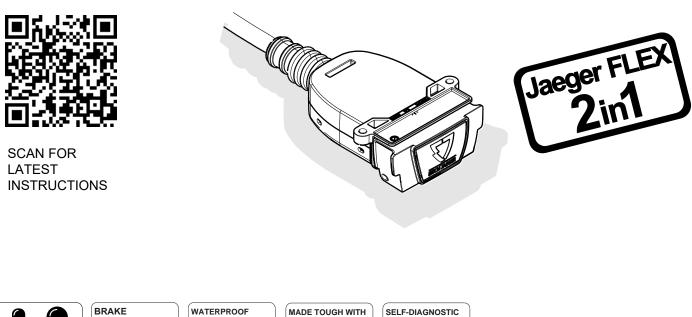

#### **Reference:**


The following information must be reviewed before beginning the assembly:


The installation instructions are to be thoroughly read.

The installation should be carried out by qualified personnel with the relevant technical knowledge. The vehicle manufacturers' current technical notices and information on retrofitting must be followed. The removal and replacement instructions found in the current repair manuals must be followed.


It must be ensured that the vehicle is technically suitable for the installation of a trailer hitch.


### **OVERVIEW**

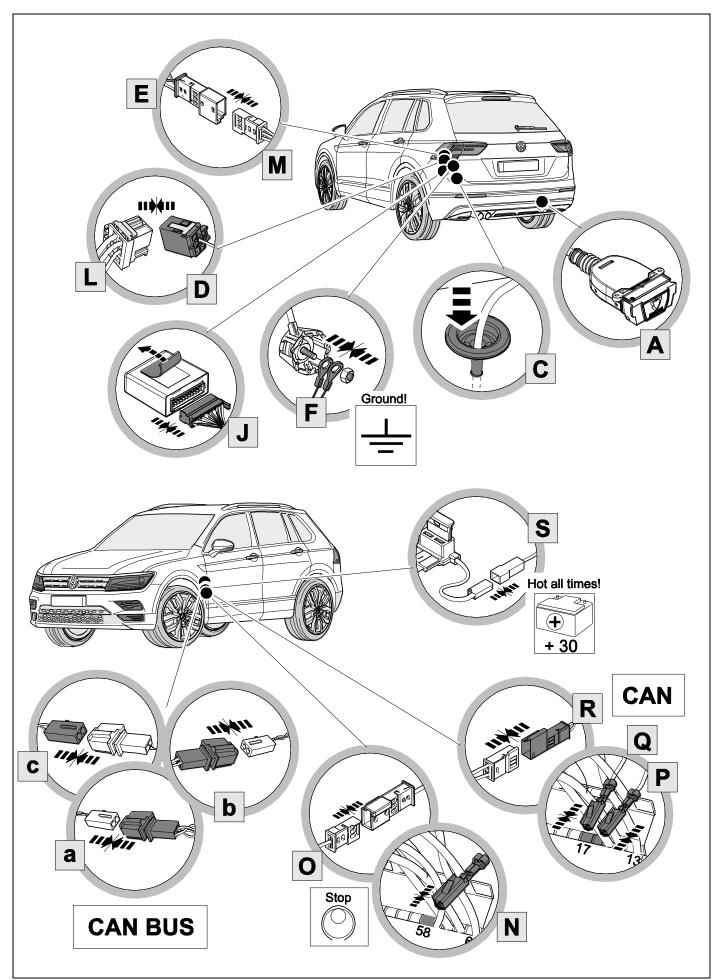

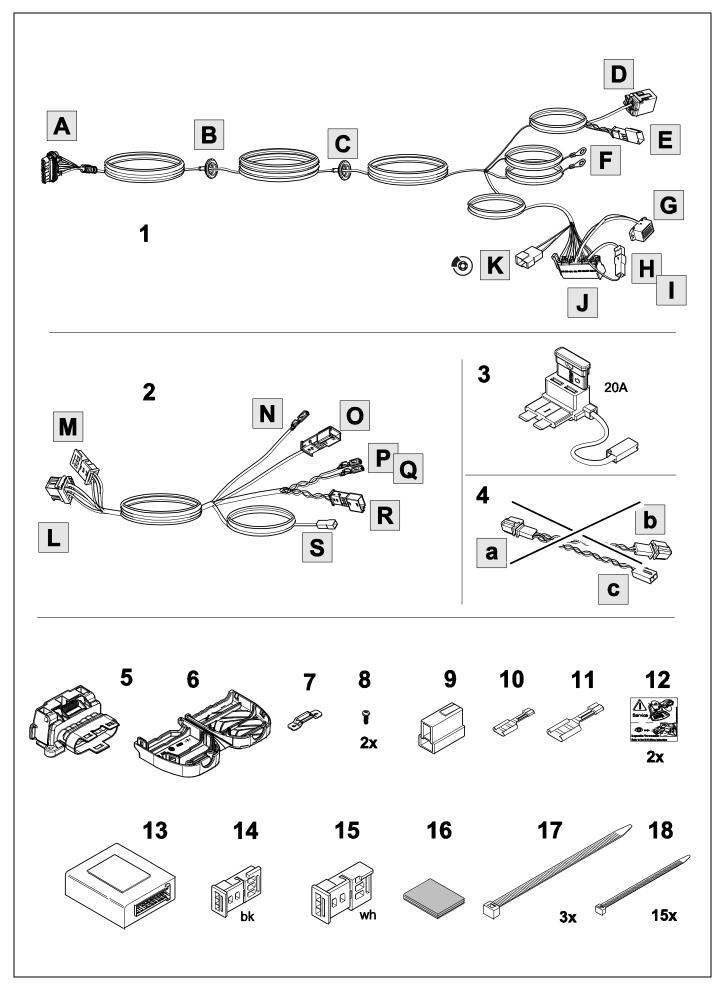



# TOOLS

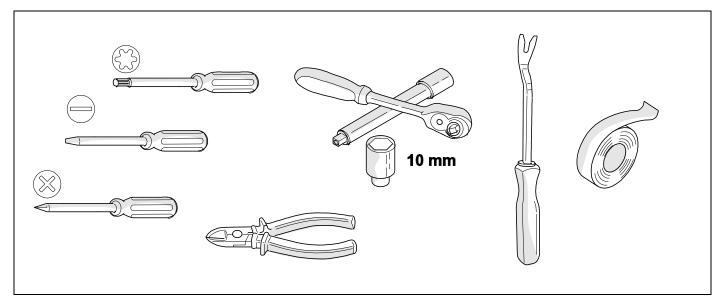


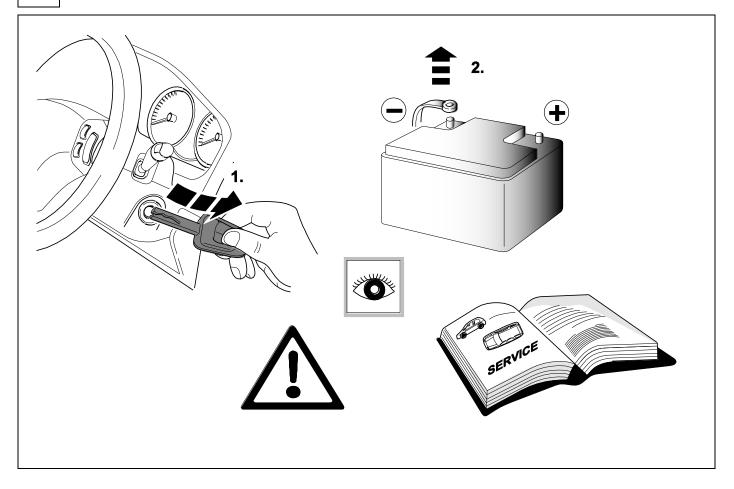


| 750071-240720 |
|---------------|
|---------------|

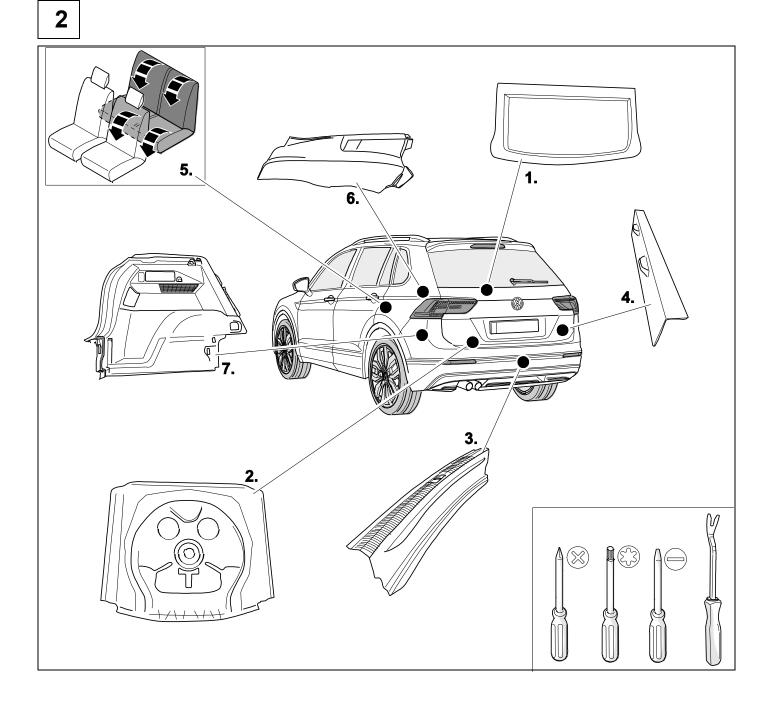


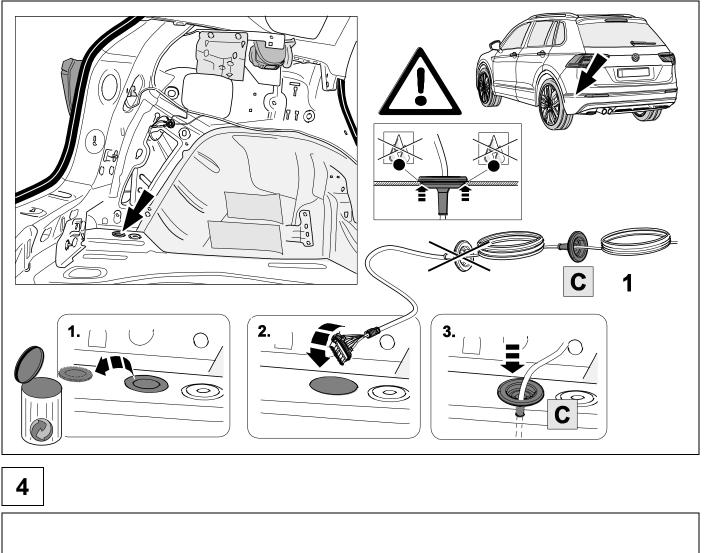

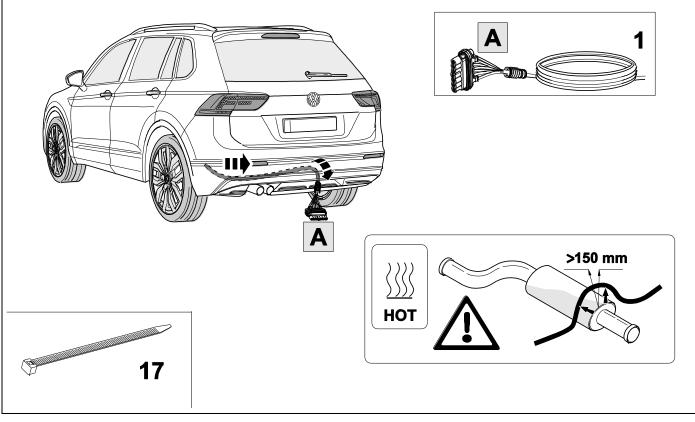


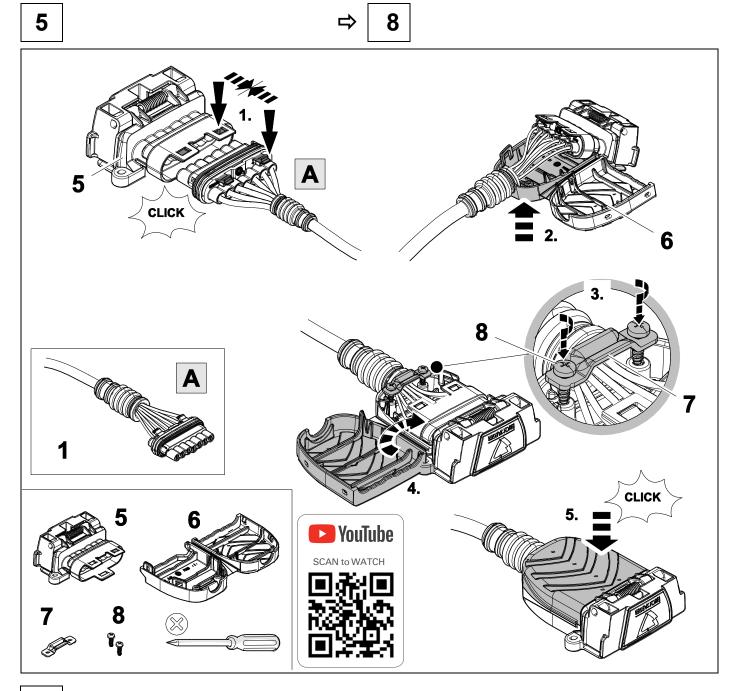




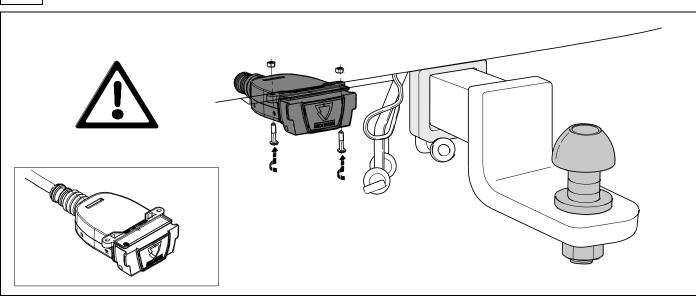


| 7 ⇒ 8 |       |       |      |       |     |      |        |       |                    |        |                 |  |
|-------|-------|-------|------|-------|-----|------|--------|-------|--------------------|--------|-----------------|--|
| 1     |       |       |      |       | уе  |      |        |       | $\bigcirc$         |        |                 |  |
| 2     |       |       |      |       | bk  |      |        |       | 13<br>2 4 <b>R</b> |        |                 |  |
| 3     |       |       |      |       | wh  |      |        |       | ÷                  |        |                 |  |
| 4     |       |       |      |       | gn  |      |        |       | $\Box$             |        |                 |  |
| 5     |       |       |      |       | bu  |      |        |       |                    |        |                 |  |
| 6     |       |       |      |       | rd  |      |        |       | Stop               |        |                 |  |
| 7     |       |       |      |       | bn  |      |        |       |                    |        |                 |  |
| 8     | bk    | wh    | gу   | gn    | rd  | bu   | ye     | bn    | pu                 | or     | no              |  |
| GB    | black | white | grey | green | red | blue | yellow | brown | purple             | orange | not<br>occupied |  |

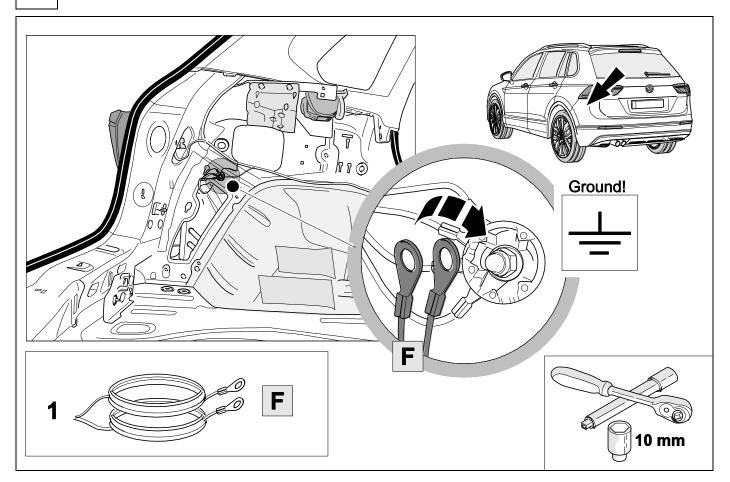





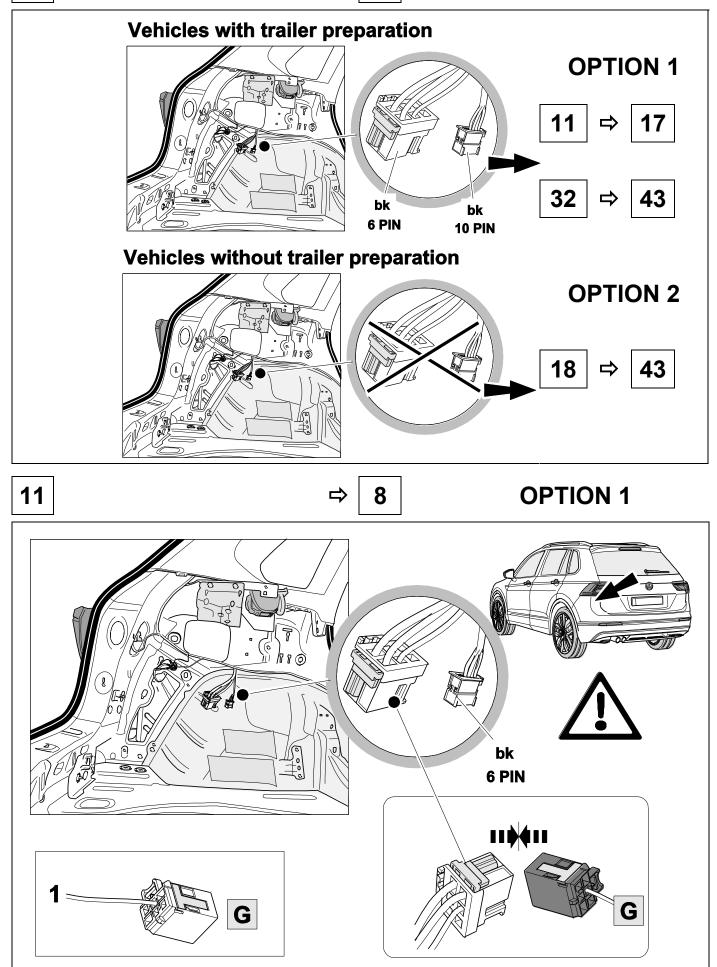



⇔

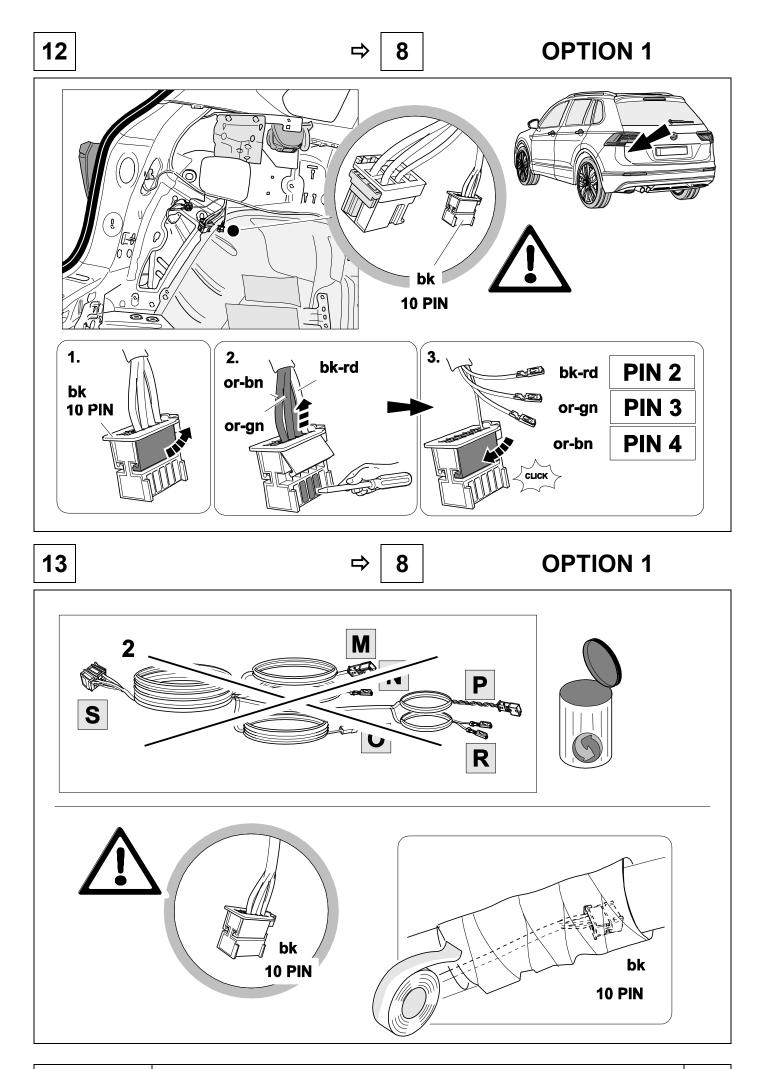


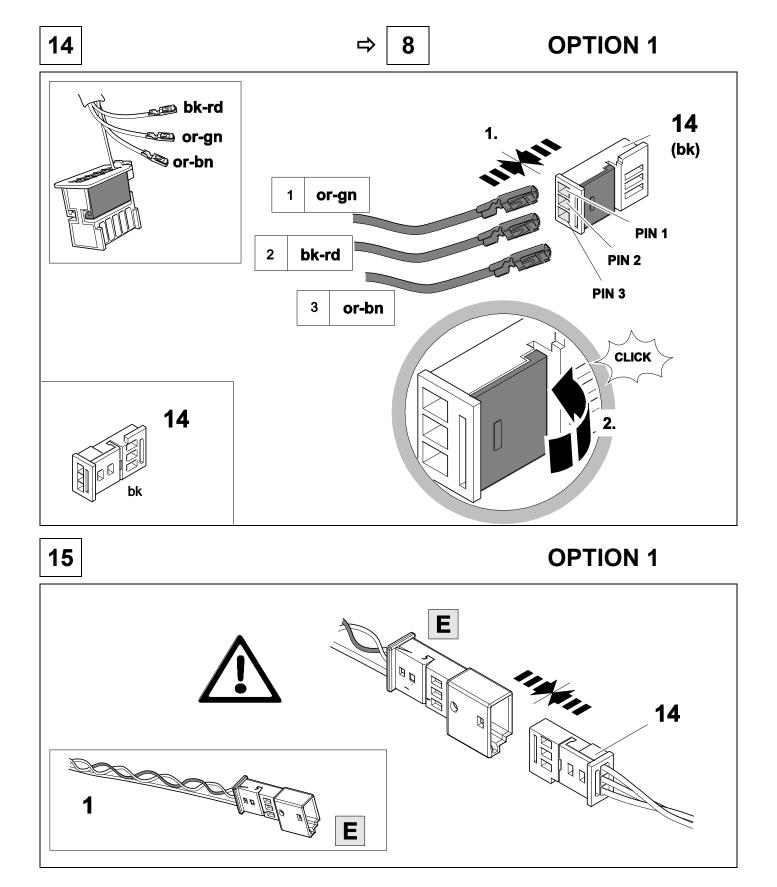


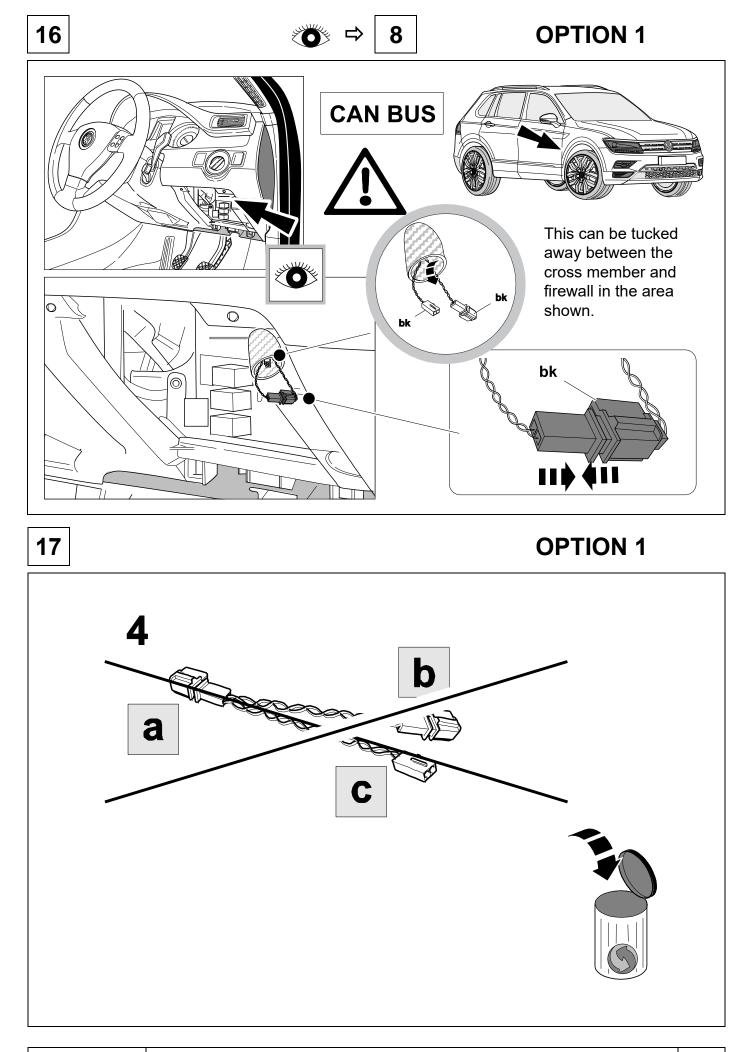


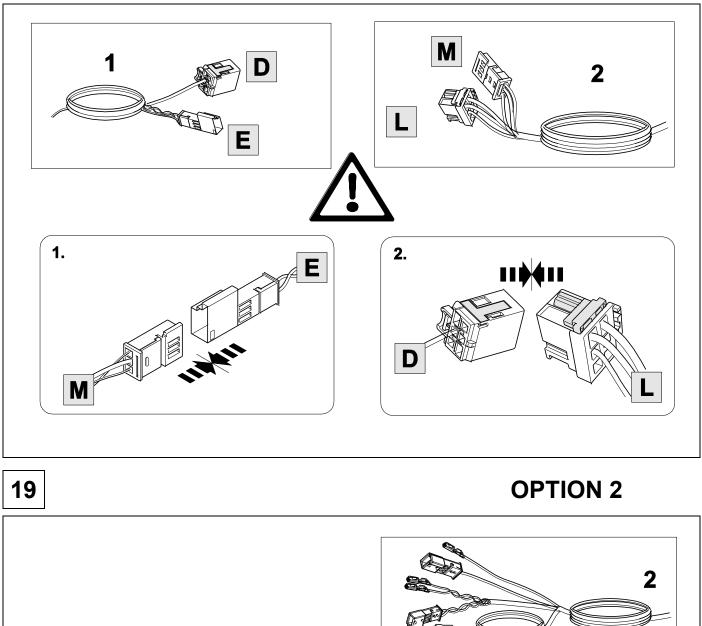

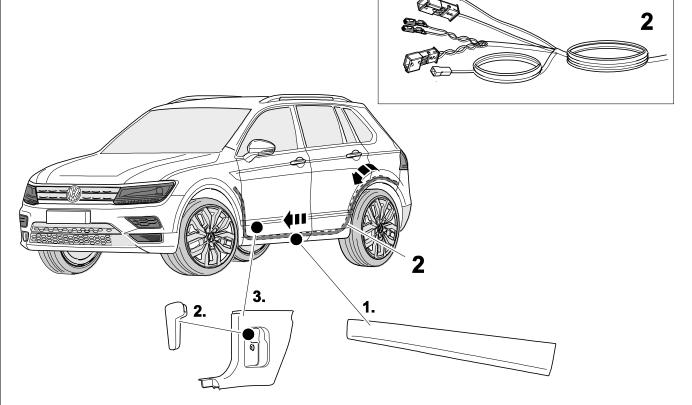

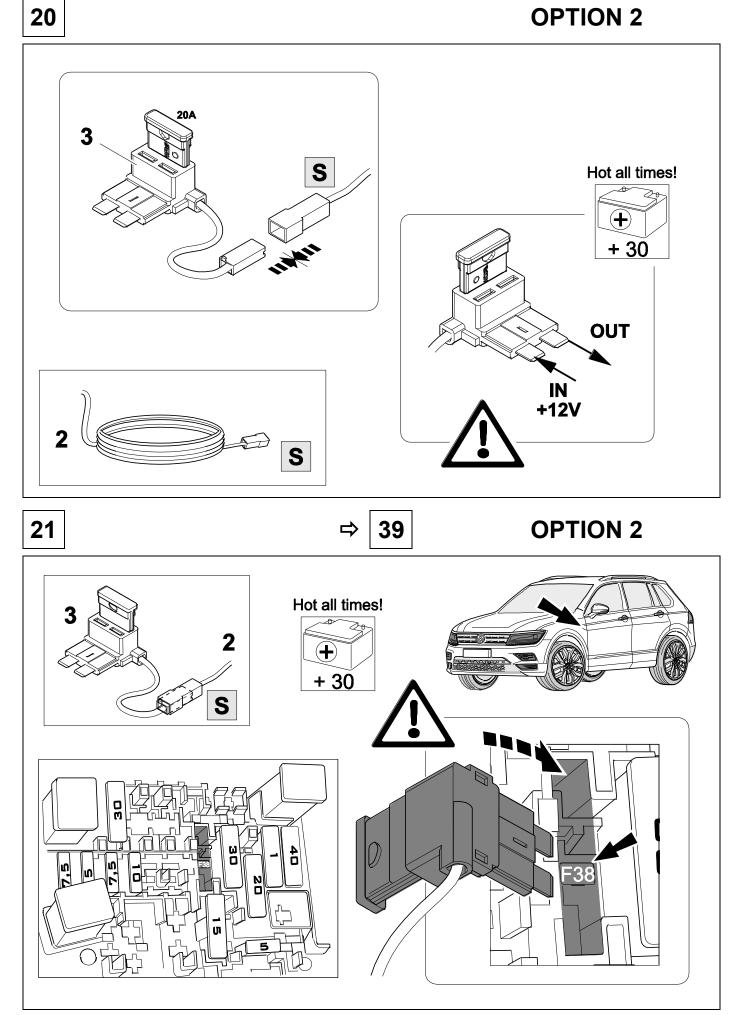

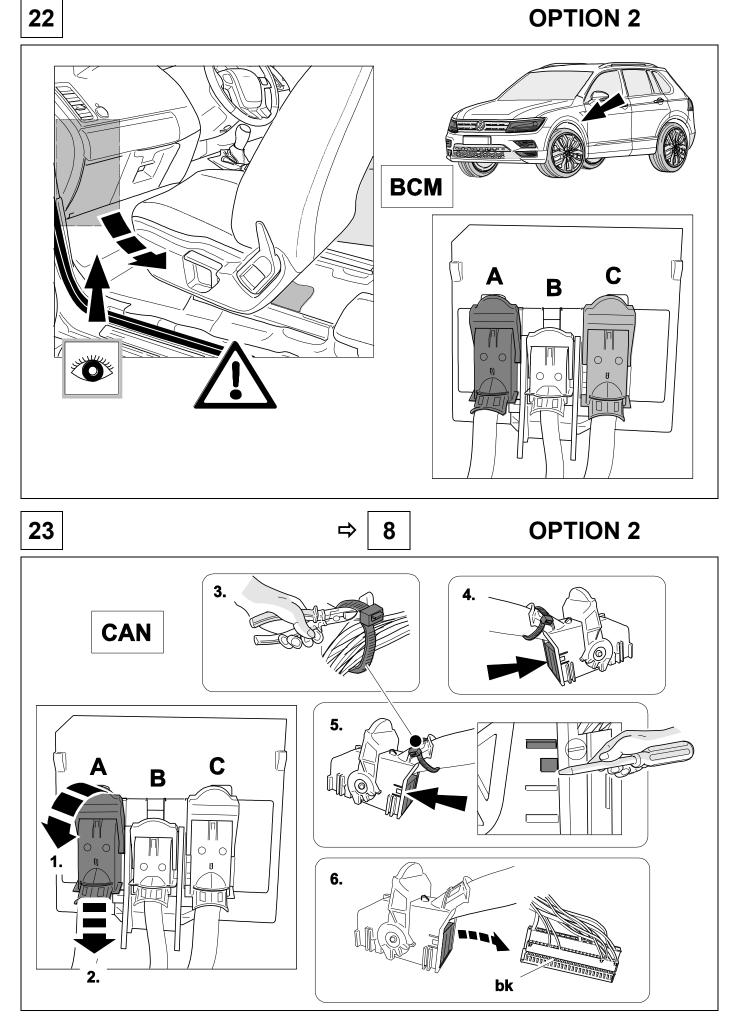


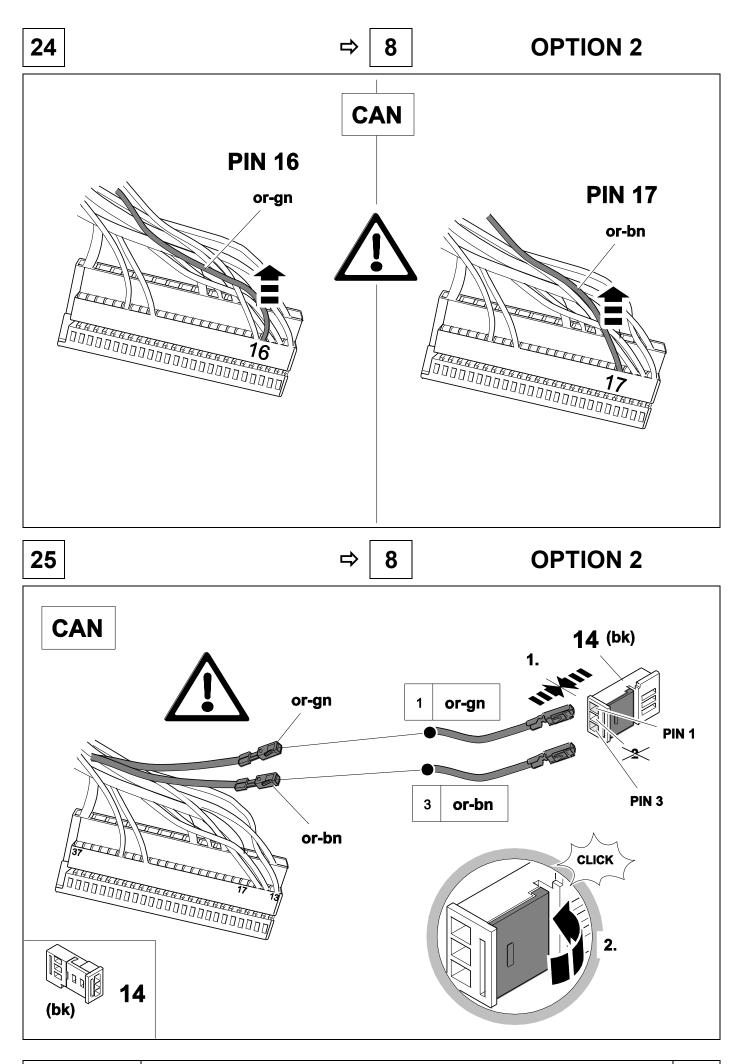






⇒


#### **OPTION 2**

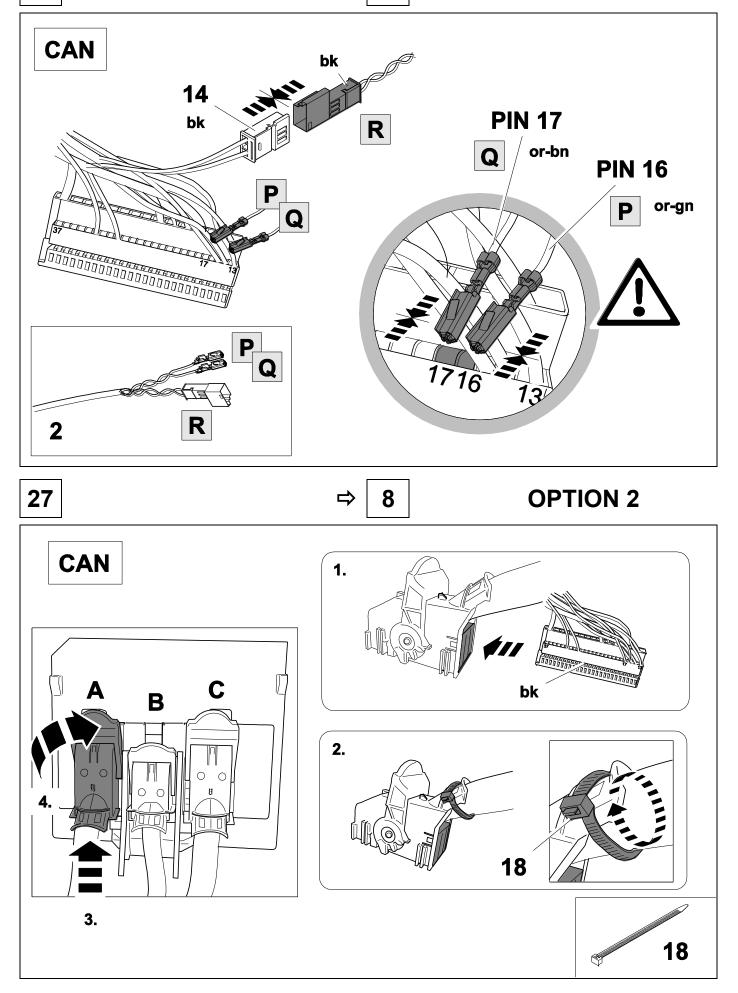

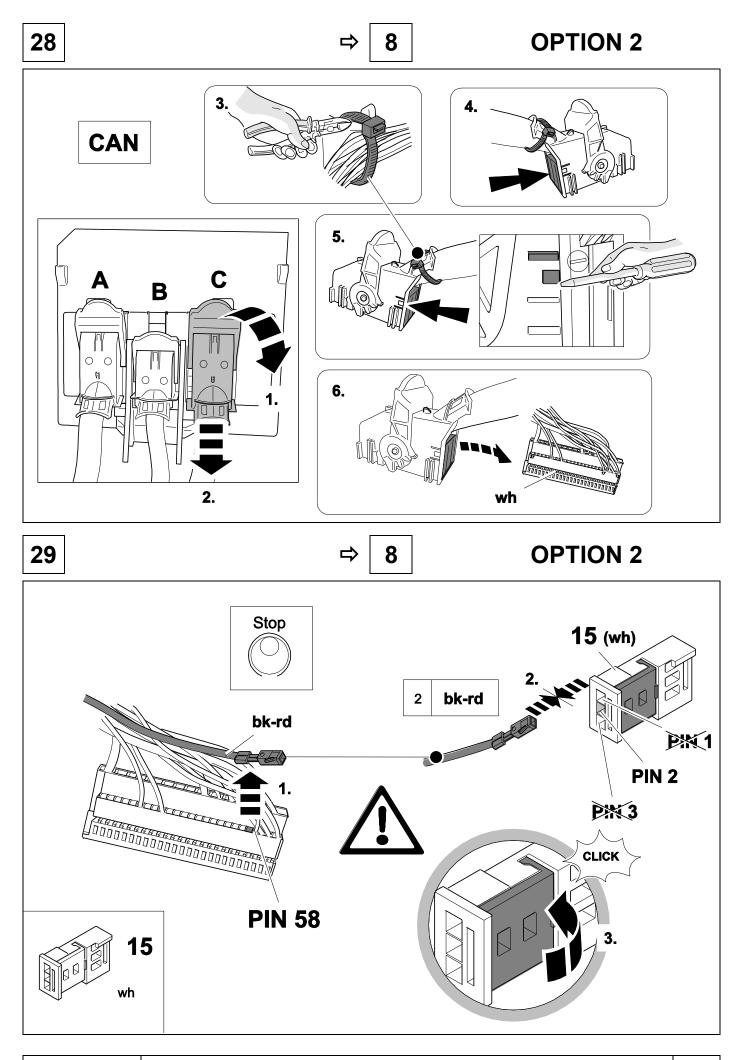


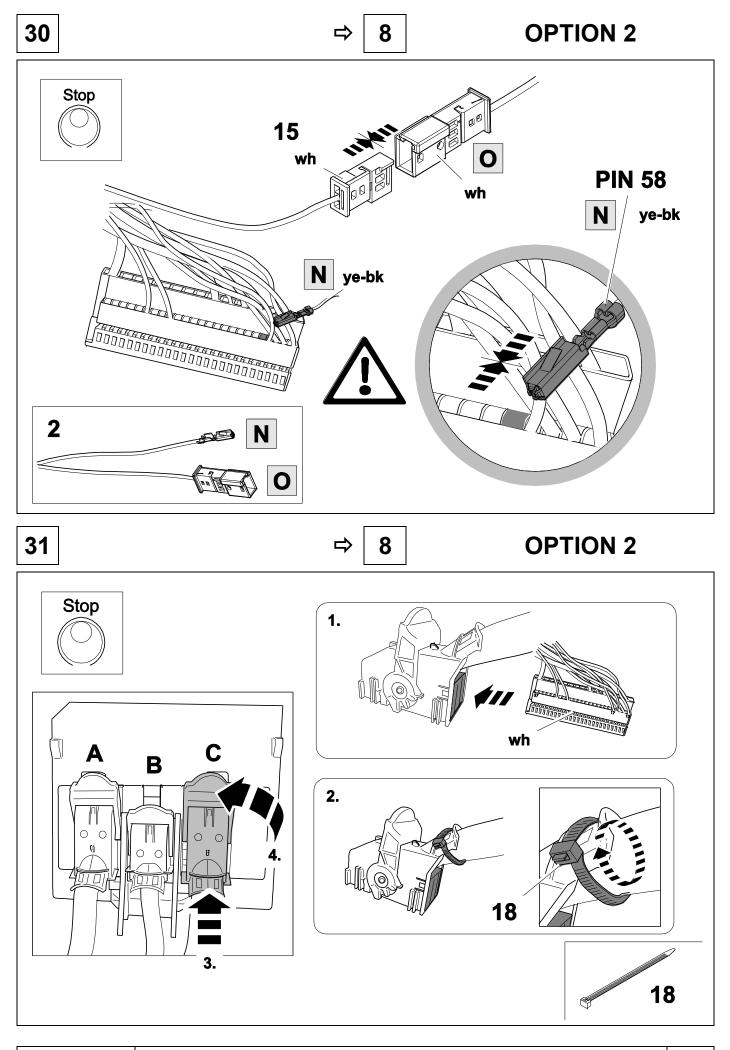

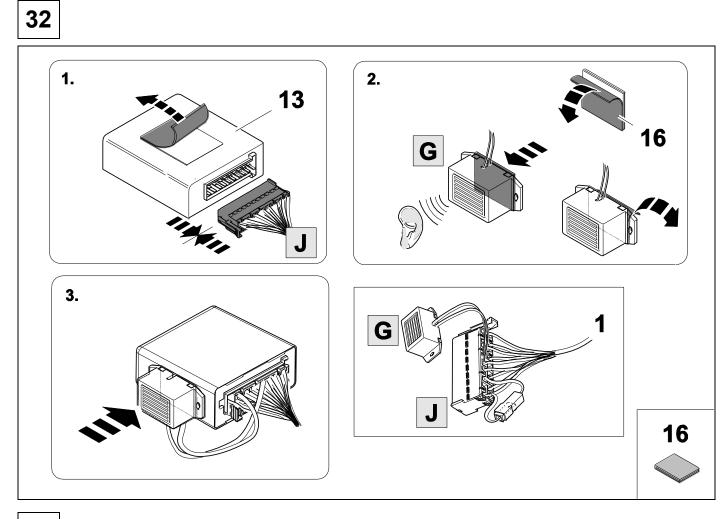

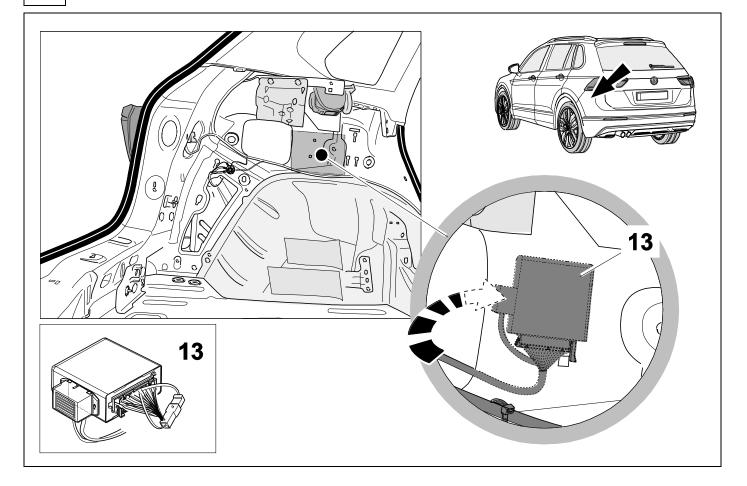



# 34 OPTIONAL

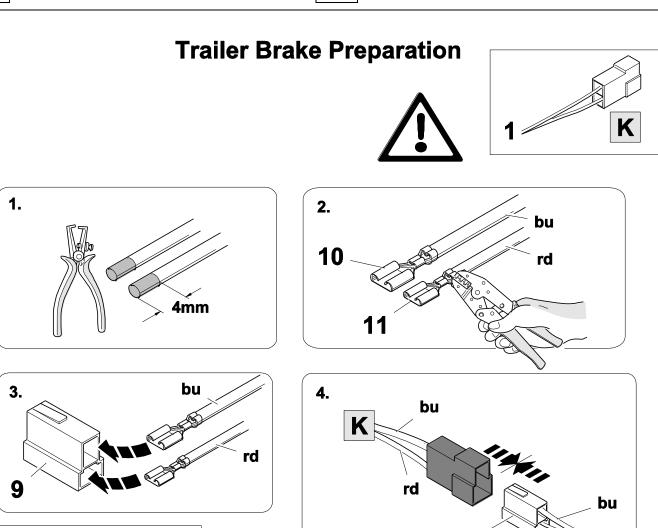



8

⇒




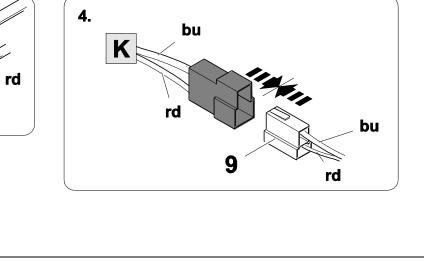


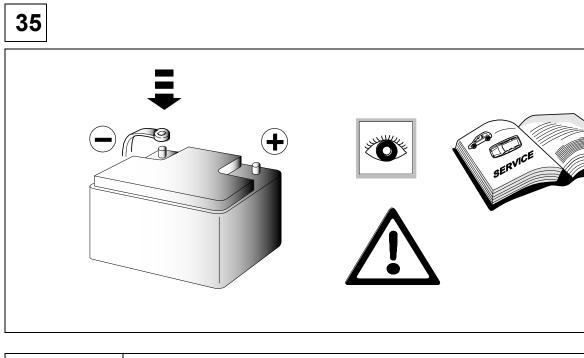


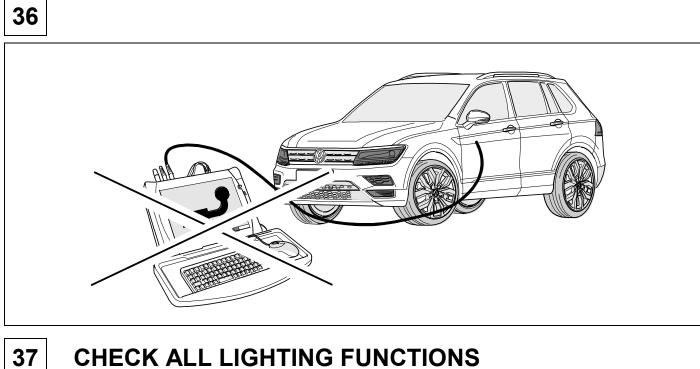

### **CHECK ALL LIGHTING FUNCTIONS**

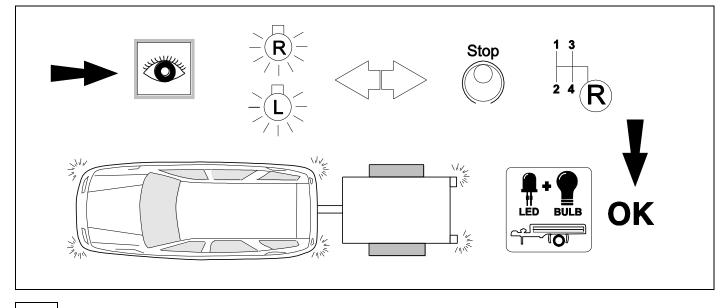


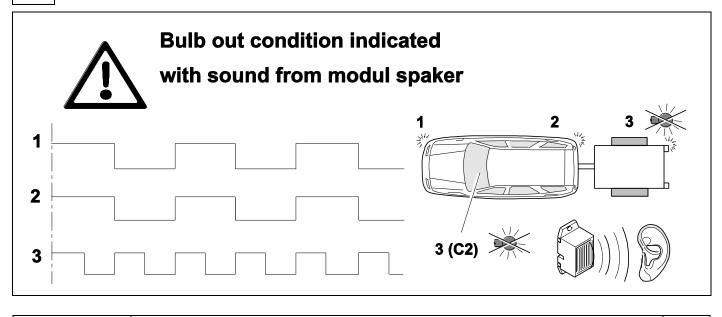

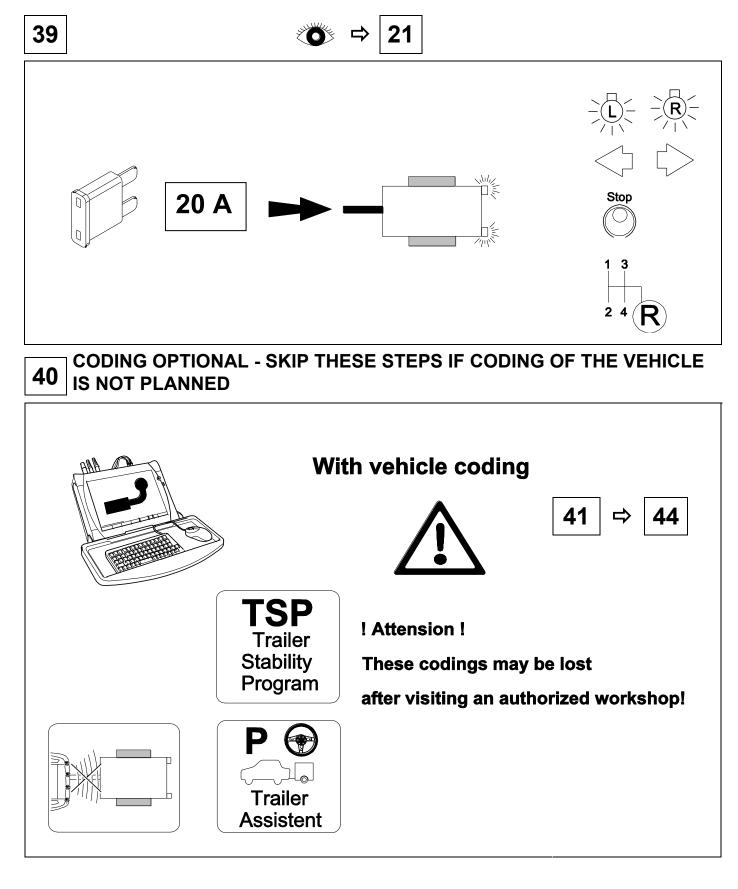



Unless you have your own coding tool and are experienced with coding VW vehicles, do not attempt coding. DO NOT take it to an VW dealer to code. They can only code their own factory kits as it requires a special one-use only unlocking code.

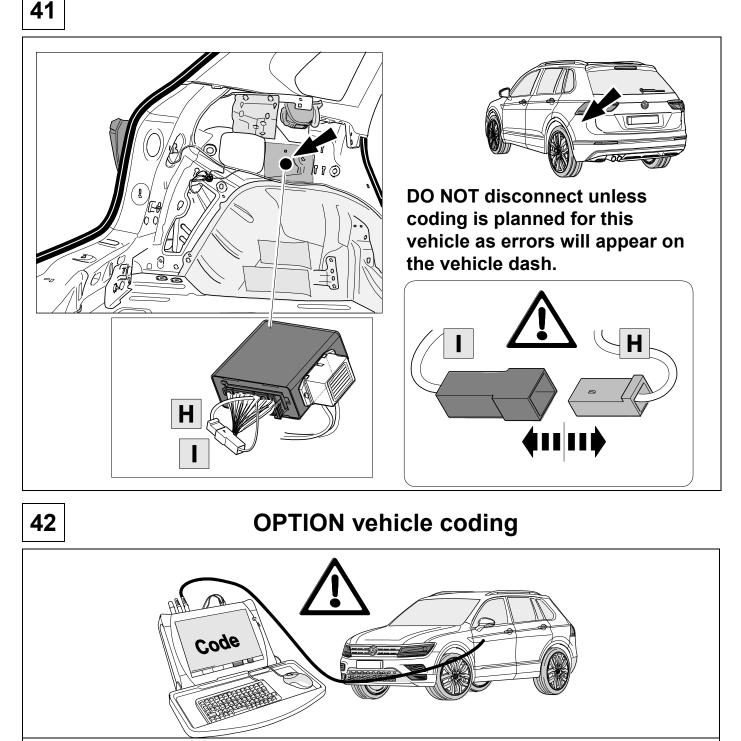

GB


For activation of the trailer function, the coding capability should be clarified / confirmed with the respective manufacturer of diagnostic coding system.


Possible diagnosis systems (local / offline):

- VCDS
- Hella Gutmann
- SP Diagnostic
- Westfalia Auto Code


If the Deactivation Loop as shown in step 41 has been disconnected in error, reconnect the loop and cycle the vehicle ignition twice to clear the error codes.

# 43 CHECK BULB OUT DETECTION

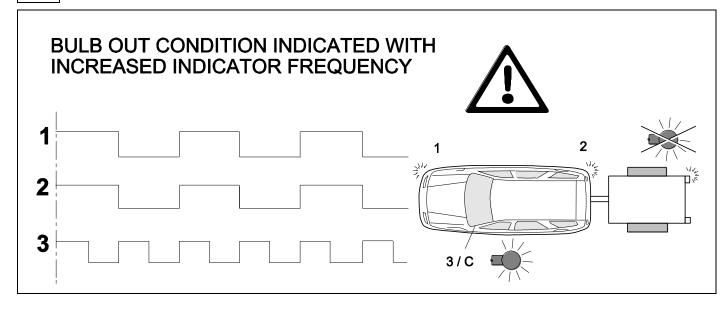


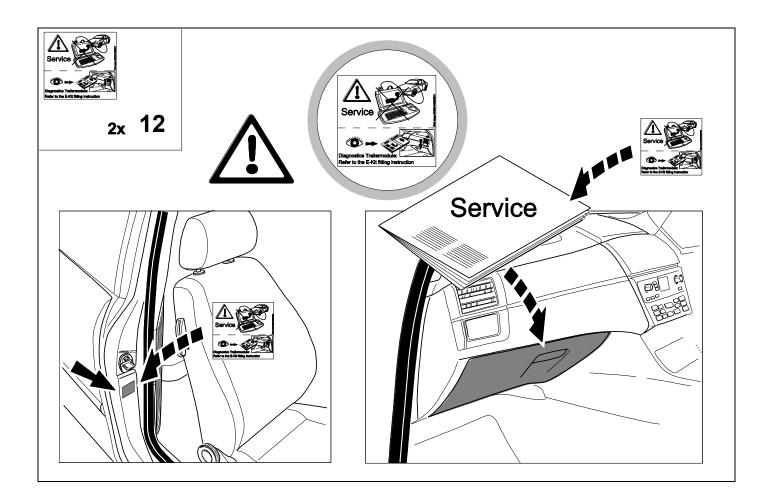

### Status LED for self-diagnosis

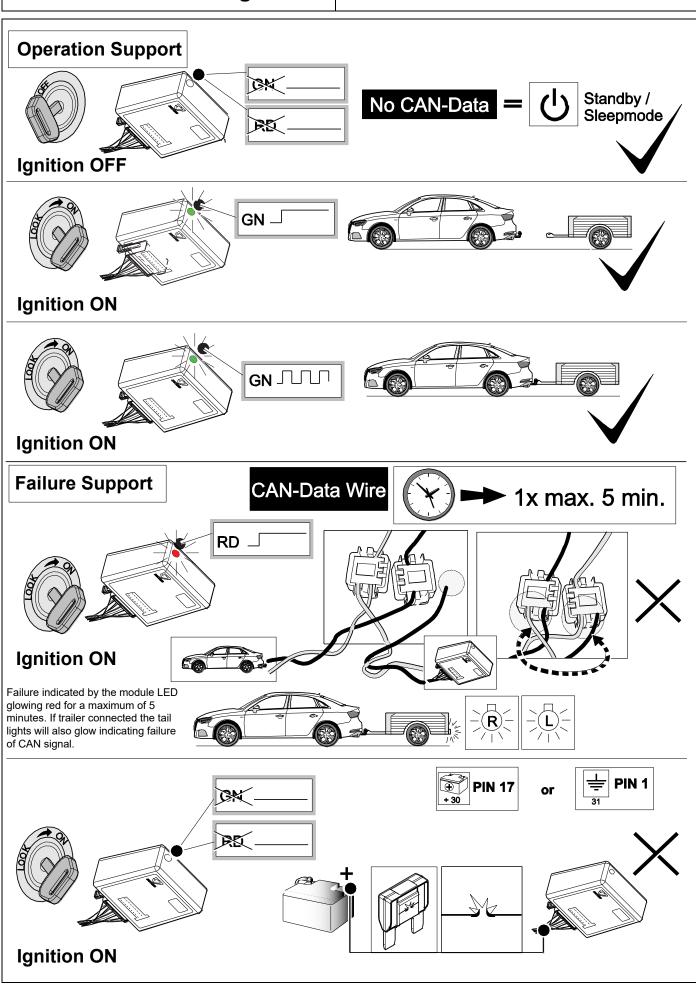

750071-240720

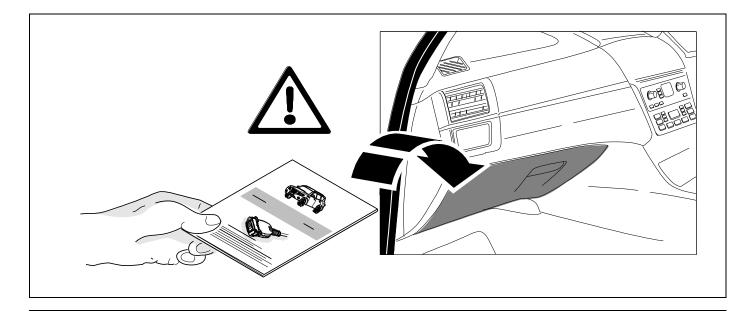



Subject to change in terms of construction, equipment and colour, and may contain errors.

The information and illustrations are non-binding.

Scan this to download instructions for other models

